



Rawhiti Golf Course Implement
Shed
Qualitative Engineering Evaluation

Functional Location ID: BU 1316 002 EQ2

Address: 104 Shaw Avenue

Reference: 227996

Prepared for:
Christchurch City Council

Revision: 2

Date: 12 December 2012

Document Control Record

Document prepared by:


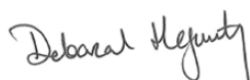
Aurecon New Zealand Limited
Level 2, 518 Colombo Street
Christchurch 8011
PO Box 1061
Christchurch 8140
New Zealand

T +64 3 375 0761
F +64 3 379 6955
E christchurch@aurecongroup.com
W aurecongroup.com

A person using Aurecon documents or data accepts the risk of:

- a) Using the documents or data in electronic form without requesting and checking them for accuracy against the original hard copy version.
- b) Using the documents or data for any purpose not agreed to in writing by Aurecon.

Document control					aurecon	
Report Title		Qualitative Engineering Evaluation				
Functional Location ID		BU 1316 002 EQ2	Project Number		227996	
File Path		P:\ 227996 - Rawhiti Golf Course Implement Shed.docx				
Client		Christchurch City Council	Client Contact		Michael Sheffield	
Rev	Date	Revision Details/Status	Prepared	Author	Verifier	Approver
1	7 March 2012	Draft	S. Manning	S.Manning	D.Hegarty	D.Hegarty
2	12 December 2012	Final	L.Castillo	L.Castillo	D.Hegarty	D.Hegarty
Current Revision		2				

Approval			
Author Signature		Approver Signature	
Name	Luis Castillo	Name	Deborah Hegarty
Title	Senior Structural Engineer	Title	Senior Structural Engineer



Contents

Executive Summary	1
1 Introduction	2
1.1 General	2
2 Description of the Building	2
2.1 Building Age and Configuration	2
2.2 Building Structural Systems Vertical and Horizontal	2
2.3 Reference Building Type	3
2.4 Building Foundation System and Soil Conditions	3
2.5 Available Structural Documentation and Inspection Priorities	3
2.6 Available Survey Information	3
3 Structural Investigation	3
3.1 Summary of Building Damage	3
3.2 Record of Intrusive Investigation	4
3.3 Damage Discussion	4
4 Building Review Summary	4
4.1 Building Review Statement	4
4.2 Critical Structural Weaknesses	4
5 Building Strength (Refer to Appendix C for background information)	4
5.1 General	4
5.2 Initial %NBS Assessment	4
5.3 Results Discussion	5
6 Conclusions and Recommendations	5
7 Explanatory Statement	6

Appendices

Appendix A Photos

Appendix B References


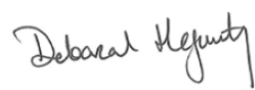
Appendix C Strength Assessment Explanation

Appendix D Background and Legal Framework

Appendix E Standard Reporting Spread Sheet

Executive Summary

This is a summary of the Qualitative Engineering Evaluation for the Rawhiti Golf Course Implement Shed building and is based on the Detailed Engineering Evaluation Procedure document issued by the Engineering Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

Building Details	Name	Rawhiti Golf Course Implement Shed			
Building Location ID	BU 1316 002 EQ2			Multiple Building Site	N
Building Address	104 Shaw Avenue			No. of residential units	0
Soil Technical Category	TC2	Importance Level	2	Approximate Year Built	1980's
Foot Print (m²)	250	Storeys above ground	1	Storeys below ground	0
Type of Construction	Steel beams supporting light timber/steel framed roof on masonry walls				
Qualitative L4 Report Results Summary					
Building Occupied	Y	Golf Club equipment and staff room.			
Suitable for Continued Occupancy	Y	Implement Shed is suitable for continued use.			
Key Damage Summary	Y	Refer to summary of building damage Section 3.1 report body.			
Critical Structural Weaknesses (CSW)	N	No critical structural weaknesses were found.			
Levels Survey Results	N	There is no evidence of differential settlement therefore a level survey is not required.			
Building %NBS From Analysis	55%	Indicative only as not an engineered building. .			
Qualitative L4 Report Recommendations					
Geotechnical Survey Required	N	There is no evidence of differential settlement therefore a level survey is not required.			
Proceed to L5 Quantitative DEE	N	A quantitative DEE is not required for this structure.			
Approval					
Author Signature			Approver Signature		
Name	Luis Castillo		Name	Deborah Hegarty	
Title	Senior Structural Engineer		Title	Senior Structural Engineer	

1 Introduction

1.1 General

On 13 January 2012 Aurecon engineers visited the Rawhiti Golf Course Implement Shed to carry out a qualitative building damage assessment on behalf of Christchurch City Council. Detailed visual inspections were carried out to assess the damage caused by the earthquakes on 4 September 2010, 22 February 2011, 13 June 2011, 23 December and related aftershocks.

The scope of work included:

- Assessment of the nature and extent of the building damage.
- Visual assessment of the building strength particularly with respect to safety of occupants if the building is currently occupied.
- Assessment of requirements for detailed engineering evaluation including geotechnical investigation, level survey and any areas where linings and floor coverings need removal to expose structural damage.

This report outlines the results of our Qualitative Assessment of damage to the Rawhiti Golf Course Implement Shed at 104 Shaw Avenue New Brighton and is based on the Detailed Engineering Evaluation Procedure document issued by the Structural Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

2 Description of the Building

2.1 Building Age and Configuration

Rawhiti Golf Course implement shed is a single storey, slab on grade, masonry structure. Light weight roofing iron is supported by light timber purlins. The purlins span between steel beams that are supported by the masonry walls. The walls are supported by a shallow concrete strip footing. The shed is approximately 250 square meters in foot print area and is considered to be an importance level 2 structure in accordance with AS/NZS 1170 Part 0:2002. The shed is made up of four rooms including the staff room facilities and an open compartment for sand storage.

2.2 Building Structural Systems Vertical and Horizontal

Transverse lateral loads are resisted by the masonry shear walls. Lateral loads originate from both the roof structure and the masonry walls. Longitudinal roof loads are resisted by the shear walls. The vertical load of the iron roofing is carried by lightweight timber purlins. The purlins are then supported by steel beams that are fixed into the top of the masonry walls. The structure is supported by concrete shallow concrete foundation pads.

2.3 Reference Building Type

The implement shed is a fully filled reinforced concrete masonry type structure. This construction type is typical of storage-implement sheds and when well-constructed is robust. This building appears to be of high standard construction.

2.4 Building Foundation System and Soil Conditions

The floor slab and foundation pads may be constructed on a number of built up layers of compacted hard fill. Soil in this area is categorised as technical category 2 (TC2) yellow meaning that it may be susceptible to liquefaction and associated settlement and may require specific design for foundations. However as noted below no evidence of liquefaction or differential settlement was observed either in the building or in the surrounding area.

2.5 Available Structural Documentation and Inspection Priorities

The identified damage was noted at the join between the main structure and the open compartment for the sand storage. The confirmation of the masonry blocks being filled with concrete was a priority for inspection as well as the steel/ masonry connections. No construction drawings were reviewed.

2.6 Available Survey Information

No levels or verticality survey information was available at the time of this report and it is not expected that any will be required as part of the DEE process.

3 Structural Investigation

3.1 Summary of Building Damage

The Rawhiti Golf Course Implement Shed is currently in use and was occupied at the time the damage assessment was carried out. The grounds man was available and was helpful in providing access and assisting with the inspection of critical structural elements.

The structural members in the structure were all exposed giving full visual access to the critical members. On inspection of the timber purlins and steel beams no visible damage was identified, this included the inspection of critical connections.

The connections between the masonry walls and beams were also identified as being undamaged. The masonry walls only had minor hairline cracks vertically.

The concrete slab foundation also had no visible cracks or displacement associated with the ground underneath the structure subject to liquefaction. On inspection of the surrounding area during the assessment and using aerial photos no liquefaction in close proximity was apparent.

On inspection of the joint between the main structure and the external compartment (as shown in appendix A) cracks have formed.

The areas of damage that were noted are summarized as follows:

- Hair line expansion cracks in masonry wall
- Cracks along joint between main structure and external compartment



3.2 Record of Intrusive Investigation

No intrusive investigation was carried out as primary structural elements were all visible.

3.3 Damage Discussion

The cracks that formed between the joint between the main building and the external compartment are most likely due to the differential movement of the two structures. The damage is minor and in our opinion does not affect the integrity of the building. These cracks do not affect the ability of the structure to resist gravity and lateral loads. The cracks in the masonry walls are also very minor and do not prevent the building from resisting loads effectively. Walls were checked acoustically by tapping and it was found that all cells were filled.

4 Building Review Summary

4.1 Building Review Statement

Because all the critical structural components of this building were assessable, each component type was able to be directly observed and reviewed. Only the foundations were not able to be directly reviewed. From the lack of visible liquefaction and cracking in the concrete slab, the foundation has been inferred as adequate.

4.2 Critical Structural Weaknesses

No critical structural weakness was identified as part of the qualitative assessment.

5 Building Strength (Refer to Appendix C for background information)

5.1 General

The building has performed well in the Canterbury earthquake sequence as evidenced by the lack of noted damage in section 3 above.

5.2 Initial %NBS Assessment

The Rawhiti Golf Course Implement Shed has not been subject to specific engineering design and the initial evaluation procedure or IEP is not an appropriate method of assessment for this building. Nevertheless an estimate of lateral load capacity can be made by adopting assumed values for strengths of existing materials and calculating the capacity of existing walls.

Selected assessment seismic parameters are tabulated in the next page.

Seismic Parameter	Quantity	Comment/Reference
Site Soil Class	D	NZS 1170.5:2004, Clause 3.1.3, Soft Soil
Site Hazard Factor, Z	0.3	Clause B1 Structure, Amendment 11 effective from 1 August 2011
Return period Factor, R_u	1	NZS 1170.5:2004, table 3.5, Importance level 2 Structure with 50 year design life
Ductility Factor in the Along Direction, μ	1	Masonry shear walls
Ductility Factor in the Across Direction, μ	1	Masonry shear walls

Table 1: Parameters used in the Seismic Assessment

The initial engineering evaluation procedure (IEP), gives a percentage new building standard (%NBS) of 55% both transversely and longitudinally. This falls into the category of moderate earthquake risk building rather than low risk or earthquake prone building.

5.3 Results Discussion

As noted above this building is not an engineered structure so this is indicative only of the standard at the time of the building's construction.

6 Conclusions and Recommendations

The land below the Rawhiti Golf Course is zoned TC2 and as such has been identified as somewhat prone to liquefaction and settlement. However there is minimal evidence of settlement and liquefaction in the area as well as the lack of cracking in the concrete slab foundation. Based on the IEP estimate the building has a moderate earthquake risk. Due to the lack of visible damage to the structure no further assessment or building consent repairs need to be undertaken.

The building is currently occupied and in use as a storage shed and lunch room and in our opinion it is considered suitable for continued occupation.

7 Explanatory Statement

The inspections of the building discussed in this report have been undertaken to assess structural earthquake damage. No analysis has been undertaken to assess the strength of the building or to determine whether or not it complies with the relevant building codes, except to the extent that Aurecon expressly indicates otherwise in the report. Aurecon has not made any assessment of structural stability or building safety in connection with future aftershocks or earthquakes – which have the potential to damage the building and to jeopardise the safety of those either inside or adjacent to the building, except to the extent that Aurecon expressly indicates otherwise in the report.

This report is necessarily limited by the restricted ability to carry out inspections due to potential structural instabilities/safety considerations, and the time available to carry out such inspections. The report does not address defects that are not reasonably discoverable on visual inspection, including defects in inaccessible places and latent defects. Where site inspections were made, they were restricted to external inspections and, where practicable, limited internal visual inspections.

To carry out the structural review, existing building drawings were obtained (where available) from the Christchurch City Council records. We have assumed that the building has been constructed in accordance with the drawings.

While this report may assist the client in assessing whether the building should be repaired, strengthened, or replaced that decision is the sole responsibility of the client.

This review has been prepared by Aurecon at the request of its client and is exclusively for the client's use. It is not possible to make a proper assessment of this review without a clear understanding of the terms of engagement under which it has been prepared, including the scope of the instructions and directions given to and the assumptions made by Aurecon. The report will not address issues which would need to be considered for another party if that party's particular circumstances, requirements and experience were known and, further, may make assumptions about matters of which a third party is not aware. No responsibility or liability to any third party is accepted for any loss or damage whatsoever arising out of the use of or reliance on this report by any third party.

Without limiting any of the above, Aurecon's liability, whether under the law of contract, tort, statute, equity or otherwise, is limited as set out in the terms of the engagement with the client.





Appendices



Appendix A

Photos

13 January 2012 – Rawhiti Golf Course Implement Shed Site Photographs

<p>Aerial photo</p>	
<p>North elevation of the Rawhiti Golf Course Implement Shed.</p>	
<p>East elevation of the Rawhiti Golf Course Implement Shed.</p>	
<p>Western Room (no visible damage)</p>	

<p>Beam/Masonry wall connection (no visible damage on initial inspection)</p>	
<p>External compartment for the sand (small cracks occurring at join with main building)</p>	
<p>Small cracks occurring in corner of external compartment</p>	
<p>Timber purlins (no visible damage)</p>	

Appendix B

References

1. Department of Building and Housing (DBH), “Revised Guidance on Repairing and Rebuilding Houses Affected by the Canterbury Earthquake Sequence”, November 2011
2. New Zealand Society for Earthquake Engineering (NZSEE), “Assessment and Improvement of the Structural Performance of Buildings in Earthquakes”, April 2012
3. Standards New Zealand, “AS/NZS 1170 Part 0, Structural Design Actions: General Principles”, 2002
4. Standards New Zealand, “AS/NZS 1170 Part 1, Structural Design Actions: Permanent, imposed and other actions”, 2002
5. Standards New Zealand, “NZS 1170 Part 5, Structural Design Actions: Earthquake Actions – New Zealand”, 2004
6. Standards New Zealand, “NZS 3101 Part 1, The Design of Concrete Structures”, 2006
7. Standards New Zealand, “NZS 3404 Part 1, Steel Structures Standard”, 1997
8. Standards New Zealand, “NZS 3603, Timber Structures Standard”, 1993
9. Standards New Zealand, “NZS 3604, Timber Framed Structures”, 2011
10. Standards New Zealand, “NZS 4229, Concrete Masonry Buildings Not Requiring Specific Engineering Design”, 1999
11. Standards New Zealand, “NZS 4230, Design of Reinforced Concrete Masonry Structures”, 2004

Appendix C

Strength Assessment Explanation

New building standard (NBS)

New building standard (NBS) is the term used with reference to the earthquake standard that would apply to a new building of similar type and use if the building was designed to meet the latest design Codes of Practice. If the strength of a building is less than this level, then its strength is expressed as a percentage of NBS.

Earthquake Prone Buildings

A building can be considered to be earthquake prone if its strength is less than one third of the strength to which an equivalent new building would be designed, that is, less than 33%NBS (as defined by the New Zealand Building Act). If the building strength exceeds 33%NBS but is less than 67%NBS the building is considered at risk.

Christchurch City Council Earthquake Prone Building Policy 2010

The Christchurch City Council (CCC) already had in place an Earthquake Prone Building Policy (EPB Policy) requiring all earthquake-prone buildings to be strengthened within a timeframe varying from 15 to 30 years. The level to which the buildings were required to be strengthened was 33%NBS.

As a result of the 4 September 2010 Canterbury earthquake the CCC raised the level that a building was required to be strengthened to from 33% to 67% NBS but qualified this as a target level and noted that the actual strengthening level for each building will be determined in conjunction with the owners on a building-by-building basis. Factors that will be taken into account by the Council in determining the strengthening level include the cost of strengthening, the use to which the building is put, the level of danger posed by the building, and the extent of damage and repair involved.

Irrespective of strengthening level, the threshold level that triggers a requirement to strengthen is 33%NBS.

As part of any building consent application fire and disabled access provisions will need to be assessed.

Christchurch Seismicity

The level of seismicity within the current New Zealand loading code (AS/NZS 1170) is related to the seismic zone factor. The zone factor varies depending on the location of the building within NZ. Prior to the 22nd February 2011 earthquake the zone factor for Christchurch was 0.22. Following the earthquake the seismic zone factor (level of seismicity) in the Christchurch and surrounding areas has been increased to 0.3. This is a 36% increase.

For this assessment, the building's earthquake resistance is compared with the current New Zealand Building Code requirements for a new building constructed on the site. This is expressed as a percentage of new building standard (%NBS). The new building standard load requirements have been determined in accordance with the current earthquake loading standard (NZS 1170.5:2004 Structural design actions - Earthquake actions - New Zealand).

The likely capacity of this building has been derived in accordance with the New Zealand Society for Earthquake Engineering (NZSEE) guidelines 'Assessment and Improvement of the Structural Performance of Buildings in Earthquakes' (AISPBE), 2006. These guidelines provide an Initial Evaluation Procedure that assesses a buildings capacity based on a comparison of loading codes from when the building was designed

and currently. It is a quick high-level procedure that can be used when undertaking a Qualitative analysis of a building. The guidelines also provide guidance on calculating a modified Ultimate Limit State capacity of the building which is much more accurate and can be used when undertaking a Quantitative analysis.

The New Zealand Society for Earthquake Engineering has proposed a way for classifying earthquake risk for existing buildings in terms of %NBS and this is shown in Figure C1 below.

Description	Grade	Risk	%NBS	Existing Building Structural Performance	Improvement of Structural Performance	
					Legal Requirement	NZSEE Recommendation
Low Risk Building	A or B	Low	Above 67	Acceptable (improvement may be desirable)	The Building Act sets no required level of structural improvement (unless change in use) This is for each TA to decide. Improvement is not limited to 34%NBS.	100%NBS desirable. Improvement should achieve at least 67%NBS
Moderate Risk Building	B or C	Moderate	34 to 66	Acceptable legally. Improvement recommended		Not recommended. Acceptable only in exceptional circumstances
High Risk Building	D or E	High	33 or lower	Unacceptable (Improvement	Unacceptable	Unacceptable

Figure C1: NZSEE Risk Classifications Extracted from table 2.2 of the NZSEE 2006 AISPBE Guidelines

Table C1 below compares the percentage NBS to the relative risk of the building failing in a seismic event with a 10% probability of exceedance in 50 years (i.e. 0.2% in the next year). It is noted that the current seismic risk in Christchurch results in a 6% probability of exceedance in the next year.

Table C1: Relative Risk of Building Failure In A

Percentage of New Building Standard (%NBS)	Relative Risk (Approximate)
>100	<1 time
80-100	1-2 times
67-80	2-5 times
33-67	5-10 times
20-33	10-25 times
<20	>25 times

Appendix D

Background and Legal Framework

Background

Aurecon has been engaged by the Christchurch City Council (CCC) to undertake a detailed engineering evaluation of the building

This report is a Qualitative Assessment of the building structure, and is based on the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011.

A qualitative assessment involves inspections of the building and a desktop review of existing structural and geotechnical information, including existing drawings and calculations, if available.

The purpose of the assessment is to determine the likely building performance and damage patterns, to identify any potential critical structural weaknesses or collapse hazards, and to make an initial assessment of the likely building strength in terms of percentage of new building standard (%NBS).

Compliance

This section contains a brief summary of the requirements of the various statutes and authorities that control activities in relation to buildings in Christchurch at present.

Canterbury Earthquake Recovery Authority (CERA)

CERA was established on 28 March 2011 to take control of the recovery of Christchurch using powers established by the Canterbury Earthquake Recovery Act enacted on 18 April 2011. This act gives the Chief Executive Officer of CERA wide powers in relation to building safety, demolition and repair. Two relevant sections are:

Section 38 – Works

This section outlines a process in which the chief executive can give notice that a building is to be demolished and if the owner does not carry out the demolition, the chief executive can commission the demolition and recover the costs from the owner or by placing a charge on the owners' land.

Section 51 – Requiring Structural Survey

This section enables the chief executive to require a building owner, insurer or mortgagee carry out a full structural survey before the building is re-occupied.

We understand that CERA will require a detailed engineering evaluation to be carried out for all buildings (other than those exempt from the Earthquake Prone Building definition in the Building Act). It is anticipated that CERA will adopt the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011. This document sets out a methodology for both qualitative and quantitative assessments.

The qualitative assessment is a desk-top and site inspection assessment. It is based on a thorough visual inspection of the building coupled with a review of available documentation such as drawings and specifications. The quantitative assessment involves analytical calculation of the buildings strength and may require non-destructive or destructive material testing, geotechnical testing and intrusive investigation.

It is anticipated that factors determining the extent of evaluation and strengthening level required will include:

- The importance level and occupancy of the building
- The placard status and amount of damage
- The age and structural type of the building
- Consideration of any critical structural weaknesses
- The extent of any earthquake damage

Building Act

Several sections of the Building Act are relevant when considering structural requirements:

Section 112 – Alterations

This section requires that an existing building complies with the relevant sections of the Building Code to at least the extent that it did prior to any alteration. This effectively means that a building cannot be weakened as a result of an alteration (including partial demolition).

Section 115 – Change of Use

This section requires that the territorial authority (in this case Christchurch City Council (CCC)) be satisfied that the building with a new use complies with the relevant sections of the Building Code 'as near as is reasonably practicable'. Regarding seismic capacity 'as near as reasonably practicable' has previously been interpreted by CCC as achieving a minimum of 67%NBS however where practical achieving 100%NBS is desirable. The New Zealand Society for Earthquake Engineering (NZSEE) recommend a minimum of 67%NBS.

Section 121 – Dangerous Buildings

The definition of dangerous building in the Act was extended by the Canterbury Earthquake (Building Act) Order 2010, and it now defines a building as dangerous if:

- in the ordinary course of events (excluding the occurrence of an earthquake), the building is likely to cause injury or death or damage to other property; or
- in the event of fire, injury or death to any persons in the building or on other property is likely because of fire hazard or the occupancy of the building; or
- there is a risk that the building could collapse or otherwise cause injury or death as a result of earthquake shaking that is less than a 'moderate earthquake' (refer to Section 122 below); or
- there is a risk that that other property could collapse or otherwise cause injury or death; or
- a territorial authority has not been able to undertake an inspection to determine whether the building is dangerous.

Section 122 – Earthquake Prone Buildings

This section defines a building as earthquake prone if its ultimate capacity would be exceeded in a 'moderate earthquake' and it would be likely to collapse causing injury or death, or damage to other property. A moderate earthquake is defined by the building regulations as one that would generate ground shaking 33% of the shaking used to design an equivalent new building.

Section 124 – Powers of Territorial Authorities

This section gives the territorial authority the power to require strengthening work within specified timeframes or to close and prevent occupancy to any building defined as dangerous or earthquake prone.

Section 131 – Earthquake Prone Building Policy

This section requires the territorial authority to adopt a specific policy for earthquake prone, dangerous and insanitary buildings.

Christchurch City Council Policy

Christchurch City Council adopted their Earthquake Prone, Dangerous and Insanitary Building Policy in 2006. This policy was amended immediately following the Darfield Earthquake of the 4th September 2010.

The 2010 amendment includes the following:

- A process for identifying, categorising and prioritising Earthquake Prone Buildings, commencing on 1 July 2012;
- A strengthening target level of 67% of a new building for buildings that are Earthquake Prone;
- A timeframe of 15-30 years for Earthquake Prone Buildings to be strengthened; and,
- Repair works for buildings damaged by earthquakes will be required to comply with the above.

The council has stated their willingness to consider retrofit proposals on a case by case basis, considering the economic impact of such a retrofit.

We anticipate that any building with a capacity of less than 33%NBS (including consideration of critical structural weaknesses) will need to be strengthened to a target of 67%NBS of new building standard as recommended by the Policy.

If strengthening works are undertaken, a building consent will be required. A requirement of the consent will require upgrade of the building to comply 'as near as is reasonably practicable' with:

- The accessibility requirements of the Building Code.
- The fire requirements of the Building Code. This is likely to require a fire report to be submitted with the building consent application.

Building Code

The building code outlines performance standards for buildings and the Building Act requires that all new buildings comply with this code. Compliance Documents published by The Department of Building and Housing can be used to demonstrate compliance with the Building Code.

After the February Earthquake, on 19 May 2011, Compliance Document B1: Structure was amended to include increased seismic design requirements for Canterbury as follows:

- Hazard Factor increased from 0.22 to 0.3 (36% increase in the basic seismic design load)
- Serviceability Return Period Factor increased from 0.25 to 0.33 (80% increase in the serviceability design loads when combined with the Hazard Factor increase)

The increase in the above factors has resulted in a reduction in the level of compliance of an existing building relative to a new building despite the capacity of the existing building not changing.

Appendix E

Standard Reporting Spread Sheet

Detailed Engineering Evaluation Summary Data

V1.11

Location		Review:	
Building Name	<input type="text" value="Rawhi GDF Course Implement Shed"/>	CE/Eng No	<input type="text" value=""/>
Building Address	<input type="text" value="Lot 10 Main North Road"/>	Company	<input type="text" value="Aurizon"/>
Legal Description	<input type="text" value=""/>	Company project number	<input type="text" value="277999"/>
		Company phone number	<input type="text" value="888888"/>
GPS south	<input type="text" value=""/>	Date of submission	<input type="text" value="13-Feb-12"/>
GPS east	<input type="text" value=""/>	Inspection Date	<input type="text" value=""/>
		Revision	<input type="text" value=""/>
Building Unique Identifier (BU)	<input type="text" value="BU 1316 - 002"/>	Is there a full report with this summary	<input type="text" value="yes"/>

Site	Site slope <input type="text" value="flat"/>	Max retaining height (m) <input type="text" value=""/>
	Soil type <input type="text" value="mixed"/>	Soil Profile (if available) <input type="text" value=""/>
	Site Class (to NZS1170.5) <input type="text" value="D"/>	
	Proximity to railway (m, if <100m) <input type="text" value=""/>	If Ground improvement on site, describe <input type="text" value=""/>
	Proximity to cliff(s) (m, if <100m) <input type="text" value=""/>	
	Proximity to cliff base (m, if <100m) <input type="text" value=""/>	Approx site elevation (m) <input type="text" value="1.00"/>

Building	No. of storeys above ground <input type="text" value="1"/>	single storey = 1	Ground floor elevation (Absolute) (m) <input type="text" value="1.00"/>
	Ground floor split <input type="text" value="yes"/>		Ground floor elevation above ground (m) <input type="text" value="0.00"/>
	Storeys below ground <input type="text" value="0"/>		
	Foundation type <input type="text" value="concrete footing"/>	If Foundation type is other, describe <input type="text" value=""/>	
	Building height (m) <input type="text" value="3.00"/>	height from ground to level of uppermost seismic mass (for IEP only) (m) <input type="text" value="2.5"/>	
	Floor footprint area (approx) <input type="text" value="200"/>		
	Age of Building (years) <input type="text" value="20"/>	Date of design <input type="text" value="1978-1992"/>	
	Strengthening present <input type="text" value="no"/>	If so, when (year) <input type="text" value=""/>	
	Use (ground floor) <input type="text" value="commercial"/>	And what load level (kg) <input type="text" value=""/>	
	Use (upper floors) <input type="text" value=""/>	Brief strengthening description <input type="text" value=""/>	
	Use notes (if required) <input type="text" value=""/>		
	Importance level (to NZS1170.5) <input type="text" value="EL"/>		

Gravity Structure	Gravity System: <input type="text" value="load bearing walls"/>	rafter type, purlin type and cladding <input type="text" value="Sawn timber, lightweight iron roofs"/>
	Floors <input type="text" value="concrete fill slab"/>	slab thickness (mm) <input type="text" value="100"/>
	Beams <input type="text" value="steel non-composite"/>	beam and connector type <input type="text" value="Sawn timber"/>
	Columns <input type="text" value="concrete masonry"/>	typical dimensions (mm x mm) <input type="text" value="1000 x 2500"/>
	Walls <input type="text" value="lily filled concrete masonry"/>	#N/A

Lateral load resisting structure	Lateral system along <input type="text" value="lily filled CMU"/>	Note: Define along and across in detailed report	note total length of wall at ground (m) <input type="text" value="2.5"/>
	Ductility assumed μ <input type="text" value="1.00"/>		wall thickness (m) <input type="text" value="0.25"/>
	Period along <input type="text" value="0.40"/>	0.01 from parameters in sheet	estimate or calculation <input type="text" value="estimated"/>
	Total deflection (ULS) (mm) <input type="text" value="25"/>		estimate or calculation <input type="text" value="estimated"/>
	maximum interstorey deflection (ULS) (mm) <input type="text" value="5"/>		estimate or calculation <input type="text" value="estimated"/>
	Lateral system across <input type="text" value="partially filled CMU"/>		note total length of wall at ground (m) <input type="text" value="1.0"/>
	Ductility assumed μ <input type="text" value="1.00"/>		wall thickness (m) <input type="text" value="0.25"/>
	Period across <input type="text" value="0.40"/>	0.40 from parameters in sheet	estimate or calculation <input type="text" value="estimated"/>
	Total deflection (ULS) (mm) <input type="text" value="25"/>		estimate or calculation <input type="text" value="estimated"/>
	maximum interstorey deflection (ULS) (mm) <input type="text" value="5"/>		estimate or calculation <input type="text" value="estimated"/>

Separations	north (mm) <input type="text" value=""/>	leave blank if not relevant
	east (mm) <input type="text" value=""/>	
	south (mm) <input type="text" value=""/>	
	west (mm) <input type="text" value=""/>	

Non-structural elements	Stairs <input type="text" value=""/>	
	Wall cladding <input type="text" value="Metal"/>	describe <input type="text" value="Lightweight iron roof cladding"/>
	Roof cladding <input type="text" value="Metal"/>	
	Glassing <input type="text" value=""/>	
	Ceiling <input type="text" value="none"/>	
	Services (el) <input type="text" value=""/>	

Available documentation	Architectural <input type="text" value="yes"/>	original designer name/date <input type="text" value=""/>
	Structural <input type="text" value="yes"/>	original designer name/date <input type="text" value=""/>
	Mechanical <input type="text" value="yes"/>	original designer name/date <input type="text" value=""/>
	Electrical <input type="text" value="yes"/>	original designer name/date <input type="text" value=""/>
	Geotech report <input type="text" value="yes"/>	original designer name/date <input type="text" value=""/>

Damage Site (refer DEE Table 4-2)	Site performance <input type="text" value="Good"/>	Describe damage <input type="text" value="Slight soil distortion"/>
	Settlement <input type="text" value="none observed"/>	notes (if applicable) <input type="text" value=""/>
	Differential settlement <input type="text" value="none observed"/>	notes (if applicable) <input type="text" value=""/>
	Liquefaction <input type="text" value="none apparent"/>	notes (if applicable) <input type="text" value=""/>
	Differential lateral spread <input type="text" value="none apparent"/>	notes (if applicable) <input type="text" value=""/>
	Ground cracks <input type="text" value="0.2mm/20m"/>	notes (if applicable) <input type="text" value=""/>
	Damage to area <input type="text" value="none apparent"/>	notes (if applicable) <input type="text" value=""/>

Building	Current Placard Status <input type="text" value="green"/>	
Along	Damage ratio <input type="text" value="100%"/>	Describe how damage ratio arrived at <input type="text" value=""/>
	Describe (summary) <input type="text" value=""/>	
Across	Damage ratio <input type="text" value="100%"/>	
	Describe (summary) <input type="text" value=""/>	
Diaphragms	Damage? <input type="text" value="no"/>	Describe: <input type="text" value=""/>
CSWs	Damage? <input type="text" value="no"/>	Describe: <input type="text" value=""/>
Pounding	Damage? <input type="text" value="no"/>	Describe: <input type="text" value=""/>
Non-structural	Damage? <input type="text" value="no"/>	Describe: <input type="text" value=""/>

Recommendations	Level of repair/strengthening required <input type="text" value="none"/>	Describe: <input type="text" value=""/>
	Building Consent required <input type="text" value="no"/>	Describe: <input type="text" value=""/>
	Interim occupancy recommendations <input type="text" value="full occupancy"/>	Describe: <input type="text" value=""/>
Along	Assessed %NBS before <input type="text" value="95%"/>	0% %NBS from IEP below
	Assessed %NBS after <input type="text" value=""/>	
Across	Assessed %NBS before <input type="text" value="95%"/>	0% %NBS from IEP below
	Assessed %NBS after <input type="text" value=""/>	

IEP	Use of this method is not mandatory - more detailed analysis may give a different answer, which would take precedence. Do not fill in fields if not using IEP.	
Period of design of building (from above) 1976-1992	h, from above: 2.5m	
Seismic Zone, if designed between 1965 and 1992 <input type="text" value="B"/>	not required for this age of building not required for this age of building	
	along <input type="text" value="0.4"/>	across <input type="text" value="0.4"/>
	(%NBS) from Fig 3.1 <input type="text" value="18.6%"/>	(%NBS) from Fig 3.1 <input type="text" value="18.6%"/>
Note 1 for specifically design public buildings, to the code of the day: pre-1965 = 1.25; 1965-1976, Zone A = 1.33; 1965-1976, Zone B = 1.2; all else 1.0		
Note 2 for RC buildings designed between 1976-1984, use 1.2		
Note 3 for buildings designed prior to 1935 use 0.8, except in Wellington (1.0)		
Final (%NBS) = <input type="text" value="17%"/>		<input type="text" value="17%"/>
2.2 Near Fault Scaling Factor	Near Fault scaling factor, from NZS1170.5, d.3.1.6 <input type="text" value="1.00"/>	
	along <input type="text" value="1"/>	across <input type="text" value="1"/>
2.3 Hazard Scaling Factor	Hazard factor Z for site from AS1170.5, Table 3.3 <input type="text" value="0.30"/>	
	Zone, from NZS4202, 1992 <input type="text" value="2.5"/>	
	Hazard scaling factor, Factor B <input type="text" value="3.33333333"/>	
2.4 Return Period Scaling Factor	Building Importance level (from above) <input type="text" value="2"/>	
	Return Period Scaling factor from Table 3.1, Factor C <input type="text" value="1.00"/>	
2.5 Ductility Scaling Factor	Assessed ductility (less than max in Table 3.2 <input type="text" value="1.00"/>	
	Ductility scaling factor: =1 from 1976 onwards, or <4, if pre-1976, from Table 3.2 <input type="text" value="1.00"/>	
	Ductility Scaling Factor, Factor D <input type="text" value="1.00"/>	
2.6 Structural Performance Scaling Factor:	Sp <input type="text" value="1.000"/>	
	Structural Performance Scaling Factor, Factor E <input type="text" value="1"/>	
2.7 Baseline %NBS, (NBS)₀ = (%NBS)₀ x A x B x C x D x E	%NBS₀ <input type="text" value="55%"/>	<input type="text" value="55%"/>
Global Critical Structural Weaknesses: (refer to NZSEE IEP Table 3.4)		
3.1. Plan Irregularity, factor A:	<input type="text" value="1.1"/>	
3.2. Vertical irregularity, Factor B:	<input type="text" value="1.1"/>	
3.3. Short columns, Factor C:	<input type="text" value="1.1"/>	
3.4. Pounding potential	Pounding effect D1, from Table to right <input type="text" value="1.0"/>	
	Height Difference effect D2, from Table to right <input type="text" value="1.1"/>	
	Therefore, Factor D <input type="text" value="1.1"/>	
3.5. Site Characteristics	<input type="text" value="1.1"/>	
3.6. Other factors, Factor F	For <3 storeys, max value =2.5, otherwise max value =1.5, no minimum Rationale for choice of F factor, if not 1 <input type="text" value=""/>	
Detail Critical Structural Weaknesses: (refer to DEE Procedure section 5)		
List any <input type="text" value=""/>		
3.7. Overall Performance Achievement ratio (PAR)	<input type="text" value="0.00"/>	<input type="text" value="0.00"/>
4.3 PAR x (%NBS)₀:	<input type="text" value="0%"/>	<input type="text" value="0%"/>
4.4 Percentage New Building Standard (%NBS), (before)	<input type="text" value="0%"/>	<input type="text" value="0%"/>



Aurecon New Zealand Limited
Level 2, 518 Colombo Street
Christchurch 8011

PO Box 1061
Christchurch 8140
New Zealand

T +64 3 375 0761
F +64 3 379 6955
E christchurch@aurecongroup.com
W aurecongroup.com

Aurecon offices are located in:
Angola, Australia, Botswana, China,
Ethiopia, Hong Kong, Indonesia,
Lesotho, Libya, Malawi, Mozambique,
Namibia, New Zealand, Nigeria,
Philippines, Singapore, South Africa,
Swaziland, Tanzania, Thailand, Uganda,
United Arab Emirates, Vietnam.