

Victoria Park – Toilets (Disabled)
Qualitative Engineering Evaluation

Reference: 228908

Prepared for:

Christchurch City
Council

Functional Location ID: PRK 1829 BLDG 009 EQ2

Revision: 2

Address: 101 Victoria Park Road, Christchurch

Date: 22 November 2012

Document Control Record

Document prepared by:

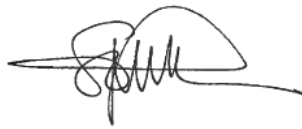

Aurecon New Zealand Limited
Unit 1, 150 Cavendish Road
Casebrook Christchurch 8051
PO Box 1061
Christchurch 8140
New Zealand

T +64 3 375 0761
F +64 3 379 6955
E christchurch@aurecongroup.com
W aurecongroup.com

A person using Aurecon documents or data accepts the risk of:

- Using the documents or data in electronic form without requesting and checking them for accuracy against the original hard copy version.
- Using the documents or data for any purpose not agreed to in writing by Aurecon.

Document control					aurecon	
Report Title		Qualitative Engineering Evaluation				
Functional Location ID		PRK 1829 BLDG 009 EQ2	Project Number		228908	
File Path		P:\ 228908 - Victoria Park – Toilets (Disabled)				
Client		Christchurch City Council	Client Contact		Michael Sheffield	
Rev	Date	Revision Details/Status	Prepared	Author	Verifier	Approver
1	5 July 2012	Draft	R. So-Beer	R. So-Beer	L. Howard	L. Howard
2	22 November 2012	Final	R. So-Beer	R. So-Beer	L. Castillo	L. Castillo
Current Revision		2				

Approval			
Author Signature		Approver Signature	
Name	Rose So-Beer	Name	Luis Castillo
Title	Structural Engineer	Title	Senior Structural Engineer

Contents

Executive Summary	1
1 Introduction	2
1.1 General	2
2 Description of the Building	2
2.1 Building Age and Configuration	2
2.2 Building Structural Systems Vertical and Horizontal	2
2.3 Reference Building Type	2
2.4 Building Foundation System and Soil Conditions	3
2.5 Available Structural Documentation and Inspection Priorities	3
2.6 Available Survey Information	3
3 Structural Investigation	3
3.1 Summary of Building Damage	3
3.2 Record of Intrusive Investigation	3
3.3 Damage Discussion	3
4 Building Review Summary	3
4.1 Building Review Statement	3
4.2 Critical Structural Weaknesses	3
5 Building Strength (Refer to Appendix C for background information)	4
5.1 General	4
5.2 Initial %NBS Assessment	4
5.3 Results Discussion	4
6 Conclusions and Recommendations	5
7 Explanatory Statement	5

Appendices

Appendix A Photos and Site Map

Appendix B References

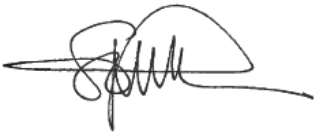

Appendix C Strength Assessment Explanation

Appendix D Background and Legal Framework

Appendix E Standard Reporting Summary Data Spread Sheet

Executive Summary

This is a summary of the Qualitative Engineering Evaluation for the Victoria Park – Toilets (Disabled) and is based on the Detailed Engineering Evaluation Procedure document issued by the Engineering Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

Building Details	Name Victoria Park – Toilets (Disabled)				
Building Location ID	PRK 1829 BLDG 009 EQ2			Multiple Building Site	Y
Building Address	101 Victoria Park Road, Christchurch			No. of residential units	0
Soil Technical Category	NA	Importance Level	2	Approximate Year Built	2005
Foot Print (m²)	11	Storeys above ground	1	Storeys below ground	0
Type of Construction	Light roof, timber framed structure, timber cladding, concrete floor slab on grade				
Qualitative L4 Report Results Summary					
Building Occupied	Y	The Victoria Park – Toilets (Disabled) is currently used as a toilet block			
Suitable for Continued Occupancy	Y	The Victoria Park – Toilets (Disabled) is suitable for continued use			
Key Damage Summary	Y	Refer to summary of building damage section 3.1 report body			
Critical Structural Weaknesses (CSW)	N	No critical structural weaknesses were identified			
Levels Survey Results	N	A floor level survey is not required			
Building %NBS From Analysis	100%	Based on analysis of the bracing capacity and demand of the building			
Qualitative L4 Report Recommendations					
Geotechnical Survey Required	N	Geotechnical survey not required due to lack of observed ground damage on site.			
Proceed to L5 Quantitative DEE	N	A quantitative DEE is not required for this structure.			
Approval					
Author Signature			Approver Signature		
Name	Rose So-Beer		Name	Luis Castillo	
Title	Structural Engineer		Title	Senior Structural Engineer	

1 Introduction

1.1 General

On 27 April 2012 Aurecon engineers visited the Victoria Park – Toilets (Disabled) to carry out a qualitative building damage assessment on behalf of Christchurch City Council. Detailed visual inspections were carried out to assess the damage caused by the earthquakes on 4 September 2010, 22 February 2011, 13 June 2011, 23 December 2011 and related aftershocks.

The scope of work included:

- Assessment of the nature and extent of the building damage.
- Visual assessment of the building strength particularly with respect to safety of occupants if the building is currently occupied.
- Assessment of requirements for detailed engineering evaluation including geotechnical investigation, level survey and any areas where linings and floor coverings need removal to expose structural damage.

This report outlines the results of our Qualitative Assessment of damage to the Victoria Park – Toilets (Disabled) and is based on the Detailed Engineering Evaluation Procedure document issued by the Structural Advisory Group on 19 July 2011, visual inspections, available structural documentation and summary calculations as appropriate.

2 Description of the Building

2.1 Building Age and Configuration

The Victoria Park – Toilets (Disabled) is a single storey lightweight timber framed building that was built in 2005. The timber truss construction supports lightweight corrugated metal roof sheeting on timber purlins. The internal linings are plasterboard and the external cladding is vertically laid timber board and batten with 150mm thick stone veneer covering the lower half of the walls. It has concrete floor slab on grade and we assume local strip footing under load bearing walls.

The approximate floor area of the building is 11 square metres. It is an importance level 2 structure in accordance with NZS 1170 Part 0:2002.

2.2 Building Structural Systems Vertical and Horizontal

The timber framed roof supports lightweight metal roof sheeting that transfer loads to the external load bearing walls. Load bearing walls are supported on concrete floor slab on grade. Lateral loads are resisted by lined timber framed walls. No plans were available for this structure

2.3 Reference Building Type

The Victoria Park – Toilets (Disabled) is a basic toilet typical of its age and style. It was not subject to specific engineering design; rather it was constructed to a reliable formula known to achieve the performance and aesthetic objectives at the time it was built.



2.4 Building Foundation System and Soil Conditions

The Toilets (Disabled) has concrete floor slab on grade and we assume it has thickening around the perimeter.

The land and surrounds of Victoria Park are zoned Port Hills and Banks Peninsula and are unlikely to be susceptible to liquefaction or differential settlement. Additionally there are no signs in the vicinity of the Toilets (Disabled) of liquefaction bulges, boils or subsidence.

2.5 Available Structural Documentation and Inspection Priorities

No architectural or structural drawings were available for the Victoria Park – Toilets (Disabled) for review. This report is solely based on internal and external visual inspections undertaken on 27 April 2012.

2.6 Available Survey Information

No floor level or verticality survey information was available at the time of this report and obtaining these is not required as part of the DEE process for this type of building.

3 Structural Investigation

3.1 Summary of Building Damage

The qualitative visual inspection of the Victoria Park – Toilets (Disabled) carried out on 27 April 2012 showed no obvious damage that could be attributed directly to the Canterbury earthquakes of 2010 and 2011.

3.2 Record of Intrusive Investigation

As the Victoria Park – Toilets (Disabled) are fully lined internally and externally, the visual inspection was limited to checking for evidence of displacement damage to the linings and finishings on the interior and exterior of the building. There was no sign of significant damage during our visual inspection, therefore an intrusive investigation was neither warranted nor undertaken.

3.3 Damage Discussion

There was no observed damage to the building as a result of seismic actions. This is not surprising as buildings of this nature are flexible and have high inherent ductility.

4 Building Review Summary

4.1 Building Review Statement

As noted above, no intrusive investigations were carried out for the Victoria Park – Toilets (Disabled). Because of the generic nature of the building, a significant amount of information can be inferred from an external and internal inspection.

4.2 Critical Structural Weaknesses

No critical structural weaknesses were identified as part of the building qualitative assessment.

5 Building Strength (Refer to Appendix C for background information)

5.1 General

The Victoria Park – Toilets (Disabled) is a typical single storey timber framed building. This type of building, due to its lightweight, flexibility and natural ductility, has typically performed well. The Toilets (Disabled) are no exception to this.

5.2 Initial %NBS Assessment

The Victoria Park – Toilets (Disabled) has not been subject to engineering design and the initial evaluation procedure or IEP is not an appropriate method of assessment for this building. Nevertheless an estimate of lateral load capacity can be made by adopting assumed values for strengths of existing materials and calculating the capacity of existing walls.

Selected assessment seismic parameters are tabulated in the Table below.

Table 1: Parameters used in the Seismic Assessment

Seismic Parameter	Quantity	Comment/Reference
Site Soil Class	C	NZS 1170.5:2004, Clause 3.1.3, Deep or Soft Soil
Site Hazard Factor, Z	0.30	DBH Info Sheet on Seismicity Changes (Effective 19 May 2011)
Return period Factor, R_u	1.0	NZS 1170.5:2004, Table 3.5. Importance Level 2 structure with a 50 year design life
Ductility Factor in Transverse Direction, μ	3	Timber framed walls
Ductility Factor in Longitudinal Direction, μ	3	Timber framed walls

The seismic demand for the Victoria Park – Toilets (Disabled) has been calculated based on the current code requirements. The capacity of the existing walls in the building has been calculated from assumed strengths of existing materials and the number and length of walls present for both the north – south and east – west directions. The seismic demand was then compared with the building capacity in both directions. The building was found to have a capacity of **100%NBS** (i.e. a ‘low’ risk building according to NZEE Guidelines).

5.3 Results Discussion

Analysis shows that the Victoria Park – Toilets (Disabled) is capable of achieving a seismic performance of **100%NBS**. This is not surprising as lightweight single story construction like that of Victoria Park – Toilets (Disabled) produces a low seismic demand.

6 Conclusions and Recommendations

The Victoria Park area is zoned as Port Hills and Banks Peninsula and as such is not expected to be prone to liquefaction and settlement. Additionally there is no local evidence of settlement and liquefaction in the surrounding land. Floor level survey has not been carried out for this building as we believe it is not required. Therefore, **a geotechnical investigation is currently not considered necessary.**

In our opinion the Victoria Park – Toilets (Disabled) **is suitable for continued use.**

7 Explanatory Statement

The inspections of the building discussed in this report have been undertaken to assess structural earthquake damage. No analysis has been undertaken to assess the strength of the building or to determine whether or not it complies with the relevant building codes, except to the extent that Aurecon expressly indicates otherwise in the report. Aurecon has not made any assessment of structural stability or building safety in connection with future aftershocks or earthquakes – which have the potential to damage the building and to jeopardise the safety of those either inside or adjacent to the building, except to the extent that Aurecon expressly indicates otherwise in the report.

This report is necessarily limited by the restricted ability to carry out inspections due to potential structural instabilities/safety considerations, and the time available to carry out such inspections. The report does not address defects that are not reasonably discoverable on visual inspection, including defects in inaccessible places and latent defects. Where site inspections were made, they were restricted to external inspections and, where practicable, limited internal visual inspections.

To carry out the structural review, existing building drawings were obtained from the Christchurch City Council records. We have assumed that the building has been constructed in accordance with the drawings.

While this report may assist the client in assessing whether the building should be strengthened, that decision is the sole responsibility of the client.

This review has been prepared by Aurecon at the request of its client and is exclusively for the client's use. It is not possible to make a proper assessment of this review without a clear understanding of the terms of engagement under which it has been prepared, including the scope of the instructions and directions given to and the assumptions made by Aurecon. The report will not address issues which would need to be considered for another party if that party's particular circumstances, requirements and experience were known and, further, may make assumptions about matters of which a third party is not aware. No responsibility or liability to any third party is accepted for any loss or damage whatsoever arising out of the use of or reliance on this report by any third party.

Without limiting any of the above, Aurecon's liability, whether under the law of contract, tort, statute, equity or otherwise, is limited as set out in the terms of the engagement with the client.

Appendices



Appendix A

Photos and Site Map

27 April 2012 – Victoria Park – Toilets (Disabled) Site Photographs



Northeast view of the building.



View of exposed timber truss.



Typical interval view.



Appendix B

References

- Standards New Zealand, “AS/NZS 1170 Parts 0,1 and 5 and commentaries”
- Standards New Zealand, “NZS 3604:2011: Timber Framed Structures”
- Standards New Zealand, “NZS 4229:1999, Concrete Masonry Buildings Not Requiring Specific Design”
- Standards New Zealand, “NZS 3404:1997, Steel Structures Standard”
- Standards New Zealand, “NZS 3101:2006, Concrete Structures Standard”
- New Zealand Society for Earthquake Engineering (NZSEE), “Assessment and Improvement of the Structural Performance of Buildings in Earthquakes June 2006”
- Engineering Advisory Group, “Guidance on Detailed Engineering Evaluation of Earthquake Affected Non-Residential Buildings in Canterbury. Part 2 Evaluation Procedure. Revision 5, 19 July 2011”

Appendix C

Strength Assessment Explanation

New building standard (NBS)

New building standard (NBS) is the term used with reference to the earthquake standard that would apply to a new building of similar type and use if the building was designed to meet the latest design Codes of Practice. If the strength of a building is less than this level, then its strength is expressed as a percentage of NBS.

Earthquake Prone Buildings

A building can be considered to be earthquake prone if its strength is less than one third of the strength to which an equivalent new building would be designed, that is, less than 33%NBS (as defined by the New Zealand Building Act). If the building strength exceeds 33%NBS but is less than 67%NBS the building is considered at risk.

Christchurch City Council Earthquake Prone Building Policy 2010

The Christchurch City Council (CCC) already had in place an Earthquake Prone Building Policy (EPB Policy) requiring all earthquake-prone buildings to be strengthened within a timeframe varying from 15 to 30 years. The level to which the buildings were required to be strengthened was 33%NBS.

As a result of the 4 September 2010 Canterbury earthquake the CCC raised the level that a building was required to be strengthened to from 33% to 67% NBS but qualified this as a target level and noted that the actual strengthening level for each building will be determined in conjunction with the owners on a building-by-building basis. Factors that will be taken into account by the Council in determining the strengthening level include the cost of strengthening, the use to which the building is put, the level of danger posed by the building, and the extent of damage and repair involved.

Irrespective of strengthening level, the threshold level that triggers a requirement to strengthen is 33%NBS.

As part of any building consent application fire and disabled access provisions will need to be assessed.

Christchurch Seismicity

The level of seismicity within the current New Zealand loading code (AS/NZS 1170) is related to the seismic zone factor. The zone factor varies depending on the location of the building within NZ. Prior to the 22nd February 2011 earthquake the zone factor for Christchurch was 0.22. Following the earthquake the seismic zone factor (level of seismicity) in the Christchurch and surrounding areas has been increased to 0.3. This is a 36% increase.

For this assessment, the building's earthquake resistance is compared with the current New Zealand Building Code requirements for a new building constructed on the site. This is expressed as a percentage of new building standard (%NBS). The new building standard load requirements have been determined in accordance with the current earthquake loading standard (NZS 1170.5:2004 Structural design actions - Earthquake actions - New Zealand).

The likely capacity of this building has been derived in accordance with the New Zealand Society for Earthquake Engineering (NZSEE) guidelines 'Assessment and Improvement of the Structural Performance of Buildings in Earthquakes' (AISPBE), 2006. These guidelines provide an Initial Evaluation Procedure that assesses a buildings capacity based on a comparison of loading codes from when the building was designed and currently. It is a quick high-level procedure that can be used when undertaking a Qualitative analysis of a building. The guidelines also provide guidance on calculating a modified Ultimate Limit State capacity of the building which is much more accurate and can be used when undertaking a Quantitative analysis.

The New Zealand Society for Earthquake Engineering has proposed a way for classifying earthquake risk for existing buildings in terms of %NBS and this is shown in Figure C1 below.

Description	Grade	Risk	%NBS	Existing Building Structural Performance	Improvement of Structural Performance	
					Legal Requirement	NZSEE Recommendation
Low Risk Building	A or B	Low	Above 67	Acceptable (improvement may be desirable)	The Building Act sets no required level of structural improvement (unless change in use) This is for each TA to decide. Improvement is not limited to 34%NBS.	100%NBS desirable. Improvement should achieve at least 67%NBS
Moderate Risk Building	B or C	Moderate	34 to 66	Acceptable legally. Improvement recommended		Not recommended. Acceptable only in exceptional circumstances
High Risk Building	D or E	High	33 or lower	Unacceptable (Improvement	Unacceptable	Unacceptable

Figure C1: NZSEE Risk Classifications Extracted from table 2.2 of the NZSEE 2006 AISPBE Guidelines

Table C1 below compares the percentage NBS to the relative risk of the building failing in a seismic event with a 10% probability of exceedance in 50 years (i.e. 0.2% in the next year). It is noted that the current seismic risk in Christchurch results in a 6% probability of exceedance in the next year.

Table C1: Relative Risk of Building Failure In A

Percentage of New Building Standard (%NBS)	Relative Risk (Approximate)
>100	<1 time
80-100	1-2 times
67-80	2-5 times
33-67	5-10 times
20-33	10-25 times
<20	>25 times

Appendix D

Background and Legal Framework

Background

Aurecon has been engaged by the Christchurch City Council (CCC) to undertake a detailed engineering evaluation of the building

This report is a Qualitative Assessment of the building structure, and is based on the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011.

A qualitative assessment involves inspections of the building and a desktop review of existing structural and geotechnical information, including existing drawings and calculations, if available.

The purpose of the assessment is to determine the likely building performance and damage patterns, to identify any potential critical structural weaknesses or collapse hazards, and to make an initial assessment of the likely building strength in terms of percentage of new building standard (%NBS).

At the time of this report, no intrusive site investigation, detailed analysis, or modelling of the building structure had been carried out. Construction drawings were made available, and these have been considered in our evaluation of the building. The building description below is based on a review of the drawings and our visual inspections.

Compliance

This section contains a brief summary of the requirements of the various statutes and authorities that control activities in relation to buildings in Christchurch at present.

Canterbury Earthquake Recovery Authority (CERA)

CERA was established on 28 March 2011 to take control of the recovery of Christchurch using powers established by the Canterbury Earthquake Recovery Act enacted on 18 April 2011. This act gives the Chief Executive Officer of CERA wide powers in relation to building safety, demolition and repair. Two relevant sections are:

Section 38 – Works

This section outlines a process in which the chief executive can give notice that a building is to be demolished and if the owner does not carry out the demolition, the chief executive can commission the demolition and recover the costs from the owner or by placing a charge on the owners' land.

Section 51 – Requiring Structural Survey

This section enables the chief executive to require a building owner, insurer or mortgagee carry out a full structural survey before the building is re-occupied.

We understand that CERA will require a detailed engineering evaluation to be carried out for all buildings (other than those exempt from the Earthquake Prone Building definition in the Building Act). It is anticipated that CERA will adopt the Detailed Engineering Evaluation Procedure document (draft) issued by the Structural Advisory Group on 19 July 2011. This document sets out a methodology for both qualitative and quantitative assessments.

The qualitative assessment is a desk-top and site inspection assessment. It is based on a thorough visual inspection of the building coupled with a review of available documentation such as drawings and specifications.

The quantitative assessment involves analytical calculation of the buildings strength and may require non-destructive or destructive material testing, geotechnical testing and intrusive investigation.

It is anticipated that factors determining the extent of evaluation and strengthening level required will include:

- The importance level and occupancy of the building
- The placard status and amount of damage
- The age and structural type of the building
- Consideration of any critical structural weaknesses
- The extent of any earthquake damage

Building Act

Several sections of the Building Act are relevant when considering structural requirements:

Section 112 – Alterations

This section requires that an existing building complies with the relevant sections of the Building Code to at least the extent that it did prior to any alteration. This effectively means that a building cannot be weakened as a result of an alteration (including partial demolition).

Section 115 – Change of Use

This section requires that the territorial authority (in this case Christchurch City Council (CCC)) be satisfied that the building with a new use complies with the relevant sections of the Building Code 'as near as is reasonably practicable'. Regarding seismic capacity 'as near as reasonably practicable' has previously been interpreted by CCC as achieving a minimum of 67%NBS however where practical achieving 100%NBS is desirable. The New Zealand Society for Earthquake Engineering (NZSEE) recommend a minimum of 67%NBS.

Section 121 – Dangerous Buildings

The definition of dangerous building in the Act was extended by the Canterbury Earthquake (Building Act) Order 2010, and it now defines a building as dangerous if:

- in the ordinary course of events (excluding the occurrence of an earthquake), the building is likely to cause injury or death or damage to other property; or
- in the event of fire, injury or death to any persons in the building or on other property is likely because of fire hazard or the occupancy of the building; or
- there is a risk that the building could collapse or otherwise cause injury or death as a result of earthquake shaking that is less than a 'moderate earthquake' (refer to Section 122 below); or
- there is a risk that that other property could collapse or otherwise cause injury or death; or
- a territorial authority has not been able to undertake an inspection to determine whether the building is dangerous.

Section 122 – Earthquake Prone Buildings

This section defines a building as earthquake prone if its ultimate capacity would be exceeded in a 'moderate earthquake' and it would be likely to collapse causing injury or death, or damage to other property. A moderate earthquake is defined by the building regulations as one that would generate ground shaking 33% of the shaking used to design an equivalent new building.

Section 124 – Powers of Territorial Authorities

This section gives the territorial authority the power to require strengthening work within specified timeframes or to close and prevent occupancy to any building defined as dangerous or earthquake prone.

Section 131 – Earthquake Prone Building Policy

This section requires the territorial authority to adopt a specific policy for earthquake prone, dangerous and insanitary buildings.

Christchurch City Council Policy

Christchurch City Council adopted their Earthquake Prone, Dangerous and Insanitary Building Policy in 2006. This policy was amended immediately following the Darfield Earthquake of the 4th September 2010.

The 2010 amendment includes the following:

- A process for identifying, categorising and prioritising Earthquake Prone Buildings, commencing on 1 July 2012;
- A strengthening target level of 67% of a new building for buildings that are Earthquake Prone;
- A timeframe of 15-30 years for Earthquake Prone Buildings to be strengthened; and,
- Repair works for buildings damaged by earthquakes will be required to comply with the above.

The council has stated their willingness to consider retrofit proposals on a case by case basis, considering the economic impact of such a retrofit.

We anticipate that any building with a capacity of less than 33%NBS (including consideration of critical structural weaknesses) will need to be strengthened to a target of 67%NBS of new building standard as recommended by the Policy.

If strengthening works are undertaken, a building consent will be required. A requirement of the consent will require upgrade of the building to comply 'as near as is reasonably practicable' with:

- The accessibility requirements of the Building Code.
- The fire requirements of the Building Code. This is likely to require a fire report to be submitted with the building consent application.

Building Code

The building code outlines performance standards for buildings and the Building Act requires that all new buildings comply with this code. Compliance Documents published by The Department of Building and Housing can be used to demonstrate compliance with the Building Code.

After the February Earthquake, on 19 May 2011, Compliance Document B1: Structure was amended to include increased seismic design requirements for Canterbury as follows:

- Hazard Factor increased from 0.22 to 0.3 (36% increase in the basic seismic design load)
- Serviceability Return Period Factor increased from 0.25 to 0.33 (80% increase in the serviceability design loads when combined with the Hazard Factor increase)

The increase in the above factors has resulted in a reduction in the level of compliance of an existing building relative to a new building despite the capacity of the existing building not changing.

Appendix E

Standard Reporting Summary Data Spread Sheet

Detailed Engineering Evaluation Summary Data

V1.11

Location			
Building Name:	Toilets (disabled)		
	Unit	No:	Street
Building Address:	Victoria Park 101 Victoria Park Road		
Legal Description:	RS 41112		
	Degrees	Min	Sec
GPS south:	43	35	23.20
GPS east:	172	38	35.15
Building Unique Identifier (CCC):	PRK 1829 BLDG 009 EQ2		
Reviewer:	Lee Howard		
CPEng No:	1008889		
Company:	Aurecon NZ Ltd		
Company project number:	228908		
Company phone number:	03 375 0761		
Date of submission:	May		
Inspection Date:	27/04/2012		
Revision:	1		
Is there a full report with this summary?	yes		

Site	
Site slope:	slope < 1 in 10
Soil type:	mixed
Site Class (to NZS1170.5):	C
Proximity to waterway (m, if <100m):	
Proximity to clifftop (m, if < 100m):	
Proximity to cliff base (m, if <100m):	
Max retaining height (m):	
Soil Profile (if available):	
If Ground improvement on site, describe:	
Approx site elevation (m):	280.00

Building	
No. of storeys above ground:	1
Ground floor split?	no
Storeys below ground:	
Foundation type:	mat slab
Building height (m):	3.40
Floor footprint area (approx):	11
Age of Building (years):	7
single storey = 1	
Ground floor elevation (Absolute) (m):	
Ground floor elevation above ground (m):	310.00
if Foundation type is other, describe:	
height from ground to level of uppermost seismic mass (for IEP only) (m):	3.4
Date of design:	2004-
Strengthening present?	no
Use (ground floor):	other (specify)
Use (upper floors):	
Use notes (if required):	use as toilet
Importance level (to NZS1170.5):	IL2
If so, when (year)?	
And what load level (%g)?	
Brief strengthening description:	

Gravity Structure	
Gravity System:	load bearing walls
Roof:	timber framed
Floors:	
Beams:	timber
Columns:	timber
Walls:	
rafter type, purlin type and cladding:	timber purlins
type:	timber
typical dimensions (mm x mm):	standard NZS3604 timber columns

Lateral load resisting structure	
Lateral system along:	lightweight timber framed walls
Ductility assumed, μ :	3.00
Period along:	0.40
Total deflection (ULS) (mm):	
maximum interstorey deflection (ULS) (mm):	
Note: Define along and across in detailed report!	
note typical wall length (m)	4.2
estimate or calculation?	estimated
estimate or calculation?	estimated
estimate or calculation?	

Lateral system across:	lightweight timber framed walls		2.65
Ductility assumed, μ :	3.00	0.00	note typical wall length (m) estimate or calculation?
Period across:	0.40		
Total deflection (ULS) (mm):			
maximum interstorey deflection (ULS) (mm):			estimate or calculation? estimated

Separations:

north (mm):		leave blank if not relevant
east (mm):		
south (mm):		
west (mm):		

Non-structural elements

Stairs:		
Wall cladding:	other light	describe vertically laid timber boards
Roof Cladding:	Metal	describe corrugated metal roof sheeting
Glazing:		
Ceilings:		
Services(list):		

Available documentation

Architectural	none	original designer name/date
Structural	none	original designer name/date
Mechanical	none	original designer name/date
Electrical	none	original designer name/date
Geotech report	none	original designer name/date

Damage

Site: (refer DEE Table 4-2)	Site performance:		Describe damage:	minimal damage
	Settlement:	none observed	notes (if applicable):	
	Differential settlement:	none observed	notes (if applicable):	
	Liquefaction:	none apparent	notes (if applicable):	
	Lateral Spread:	none apparent	notes (if applicable):	
	Differential lateral spread:	none apparent	notes (if applicable):	
	Ground cracks:	none apparent	notes (if applicable):	
	Damage to area:		notes (if applicable):	

Building:

	Current Placard Status:	green	
Along	Damage ratio:	0%	Describe how damage ratio arrived at:
	Describe (summary):		
Across	Damage ratio:	0%	$Damage_Ratio = \frac{(\%NBS\ (before) - \%NBS\ (after))}{\%NBS\ (before)}$
	Describe (summary):		
Diaphragms	Damage?:	no	Describe:
CSWs:	Damage?:	no	Describe:
Pounding:	Damage?:	no	Describe:
Non-structural:	Damage?:	no	Describe:

Recommendations

Level of repair/strengthening required: none
Building Consent required: no
Interim occupancy recommendations: full occupancy

Describe:
Describe:
Describe:

Along Assessed %NBS before e'quakes: 100% 0% %NBS from IEP below
Assessed %NBS after e'quakes: 100%
Across Assessed %NBS before e'quakes: 100% 0% %NBS from IEP below
Assessed %NBS after e'quakes: 100%

If IEP not used, please detail %NBS based on calculations
assessment methodology:

IEP

Use of this method is not mandatory - more detailed analysis may give a different answer, which would take precedence. Do not fill in fields if not using IEP

Period of design of building (from above): 2004-

h_n from above: 3.4m

Seismic Zone, if designed between 1965 and 1992: B

Design Soil type from NZS1170.5:2004, cl 3.1.3: C shallow soil
not required for this age of building b) Intermediate

	along	across
Period (from above):	0.4	0.4
(%NBS) _{nom} from Fig 3.3:		

Note:1 for specifically design public buildings, to the code of the day: pre-1965 = 1.25; 1965-1976, Zone A = 1.33; 1965-1976, Zone B = 1.2; all else 1.0	1.00
Note 2: for RC buildings designed between 1976-1984, use 1.2	1.0
Note 3: for buildings designed prior to 1935 use 0.8, except in Wellington (1.0)	1.0

	along	across
Final (%NBS) _{nom} :	0%	0%

2.2 Near Fault Scaling Factor

Near Fault scaling factor, from NZS1170.5, cl 3.1.6: 1.00

	along	across
Near Fault scaling factor (1/N(T,D), Factor A:	1	1

2.3 Hazard Scaling Factor

Hazard factor Z for site from AS1170.5, Table 3.3:	0.30
Z ₁₉₉₂ , from NZS4203:1992	0.8
Hazard scaling factor, Factor B:	2.666666667

2.4 Return Period Scaling Factor

Building Importance level (from above):	2
Return Period Scaling factor from Table 3.1, Factor C:	1.00

2.5 Ductility Scaling Factor

	along	across
Assessed ductility (less than max in Table 3.2)		
Ductility scaling factor: =1 from 1976 onwards; or = μ , if pre-1976, from Table 3.3:	1.00	1.00
Ductility Scaling Factor, Factor D:	1.00	1.00

2.6 Structural Performance Scaling Factor:

Sp:	0.700	0.700
Structural Performance Scaling Factor Factor E:	1.428571429	1.428571429

2.7 Baseline %NBS, (NBS%)_b = (%NBS)_{nom} x A x B x C x D x E

%NBS _b :	0%	0%
---------------------	----	----

Global Critical Structural Weaknesses: (refer to NZSEE IEP Table 3.4)

3.1. Plan Irregularity, factor A:

3.2. Vertical irregularity, Factor B:

3.3. Short columns, Factor C:

3.4. Pounding potential
Pounding effect D1, from Table to right
Height Difference effect D2, from Table to right

Therefore, Factor D:

3.5. Site Characteristics

Table for selection of D1	Severe	Significant	Insignificant/none
	0<sep<.005H	.005<sep<.01H	Sep>.01H
Separation			
Alignment of floors within 20% of H	0.7	0.8	1
Alignment of floors not within 20% of H	0.4	0.7	0.8

Table for Selection of D2	Severe	Significant	Insignificant/none
	0<sep<.005H	.005<sep<.01H	Sep>.01H
Separation			
Height difference > 4 storeys	0.4	0.7	1
Height difference 2 to 4 storeys	0.7	0.9	1
Height difference < 2 storeys	1	1	1

3.6. Other factors, Factor F

For ≤ 3 storeys, max value =2.5, otherwise max valule =1.5, no minimum

Rationale for choice of F factor, if not 1

Along	Across
<input type="text" value="1.0"/>	<input type="text" value="1.0"/>
<input type="text"/>	<input type="text"/>

Detail Critical Structural Weaknesses: (refer to DEE Procedure section 6)

List any:

Refer also section 6.3.1 of DEE for discussion of F factor modification for other critical structural weaknesses

3.7. Overall Performance Achievement ratio (PAR)

<input type="text" value="1.00"/>	<input type="text" value="1.00"/>
-----------------------------------	-----------------------------------

4.3 PAR x (%NBS)b:

PAR x Baseline %NBS:	<input type="text" value="0%"/>	<input type="text" value="0%"/>
----------------------	---------------------------------	---------------------------------

4.4 Percentage New Building Standard (%NBS), (before)

<input type="text" value="0%"/>



**Aurecon New Zealand Limited
Unit 1, 150 Cavendish Road
Casebrook Christchurch 8051**

PO Box 1061
Christchurch 8140
New Zealand

T +64 3 375 0761
F +64 3 379 6955
E christchurch@aurecongroup.com
W aurecongroup.com

Aurecon offices are located in:
Angola, Australia, Botswana, China,
Ethiopia, Hong Kong, Indonesia,
Lesotho, Libya, Malawi, Mozambique,
Namibia, New Zealand, Nigeria,
Philippines, Singapore, South Africa,
Swaziland, Tanzania, Thailand, Uganda,
United Arab Emirates, Vietnam.